Remote Control Console 8570 Recommended Spares Kit 17–30082



Introduction

The Remote Control Console 8570 has a Recommended Spares Kit (RSK) 17–30082. When the console was upgraded from an A serial number (08–04124–000) to a B serial number (08–04124–500), the mains transformer was also changed from 44–02172 to 44–02210.

The transformer was changed to provided adequate power for auxiliary equipment such as the IPC-500C and 9001/9002 modems.

Symptom

 
When auxiliary equipment is attached to the 8570, there will be an inadequate power supply for its correct function.

Cause

The change to the mains transformer was not reflected in the RSK. The contents of the RSK have been incorrect since May 1994.

Action

Those customers who have purchased an RSK for a B serial number Remote Control Console 8570 will need to provide Codan with the serial number of their unit so that a replacement transformer can be issued.



Telex

858355