# 9323/9360/9780 HF SSB Transceiver software upgrade



#### Introduction

This service bulletin affects users of a single site, remote controlled system with software versions 3.08 to 4.32 in the transceiver. The affected system will include either a 9001 or 9002 modem, but no Automatic Link Establishment (ALE) controller.

### **Symptom**

The system will not allow the modem to PTT in response to an incoming data call if the system is scanning at the time of the call.

#### **Action**

Users of a single site, remote controlled system with 9001/9002 (no ALE) and software versions 3.08 to 4.32 inclusive must upgrade their transceiver software to version 4.33.

# Finding the software version of your transceiver using the remote control console

Press **Function**, then enter the function code **10** within two seconds followed by **Enter**.

The display on the remote control console will show the software version of the transceiver.



858355

Telex

Finding the	software	version	of your	transceiver	using the	e transceiver

Press <b>Mode</b> until you see a display that is simi	lar to the following.
Option TxE No of Channels: EXIT	12 SLOES NEXT
Rotate <b>Select</b> or press <b>F2/NEXT</b> until you see transceiver.	the software version for the

## **Compatibility**

Software version 4.33 supports Computer Interface Command System (CICS) version 2.10. It is fully backward compatible with CICS version 2.00.

For further information on software compatibility, see Service Bulletin "9323/9360/9780/9390 Software Compatibility Summary", Codan part number 17–00156.